



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	207	Date:	10/13/2004	MeterBasin:	01_WR27
Observer ID:	A	Crew:	T-1	Dye Test Recommended:	Y
Defect No:	1	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6320		Wirt	AVE

Source Type:	14= Catch Basin	Location:	6=Curb	Severity:
Sector:	1=Public	Drainage Area:	1000	

Comments:

SMOKE TEST PHOTOS



Photo No: 25

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_A\A_2004_1013Image0025.JPG

Image Status: Image found and displayed.



Photo No: 26

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_A\A_2004_1013Image0026.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

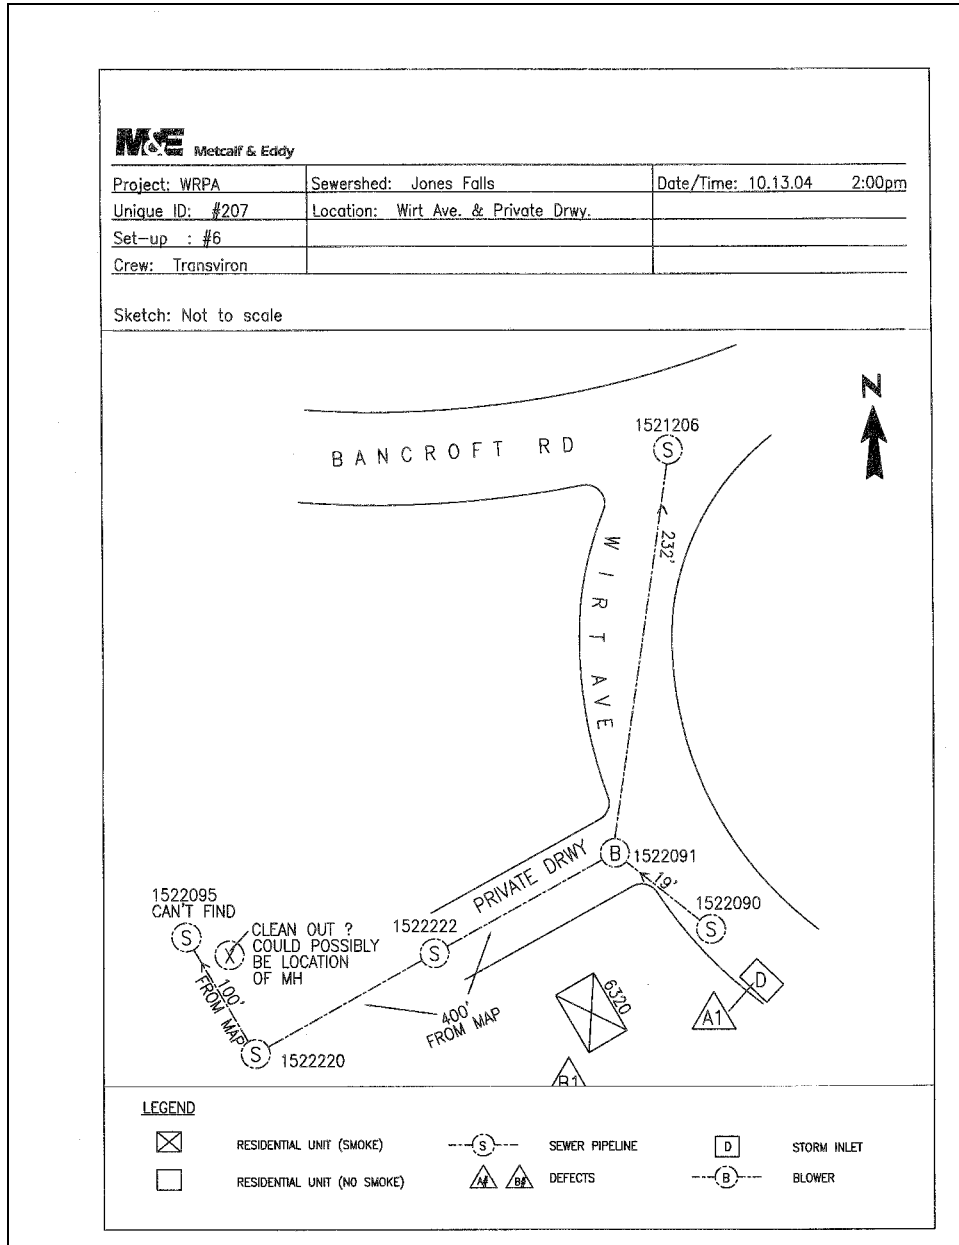

Sketch No: 207

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\207.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	207	Date:	10/13/2004	MeterBasin:	01_WR27
Observer ID:	B	Crew:	T-1	Dye Test Recommended:	N
Defect No:	1	Setup No:	6	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6320		Wirt	AVE

Source Type:	02= Service Line	Location:	8=Yard-Back	Severity:
Sector:	2=Private	Drainage Area:	50	

Comments:

SMOKE TEST PHOTOS



Photo No: 32

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\1013-2004\T-1\PLAYER_B\B_2004_1013Image0032.JPG

Image Status: Image found and displayed.



Photo No: 33

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\1013-2004\T-1\PLAYER_B\B_2004_1013Image0033.JPG

Image Status: Image found and displayed.



Photo No: 12

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Retakes\UTID207-B1_2005_0517Image012.JPG


Image Status: Image found and displayed.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

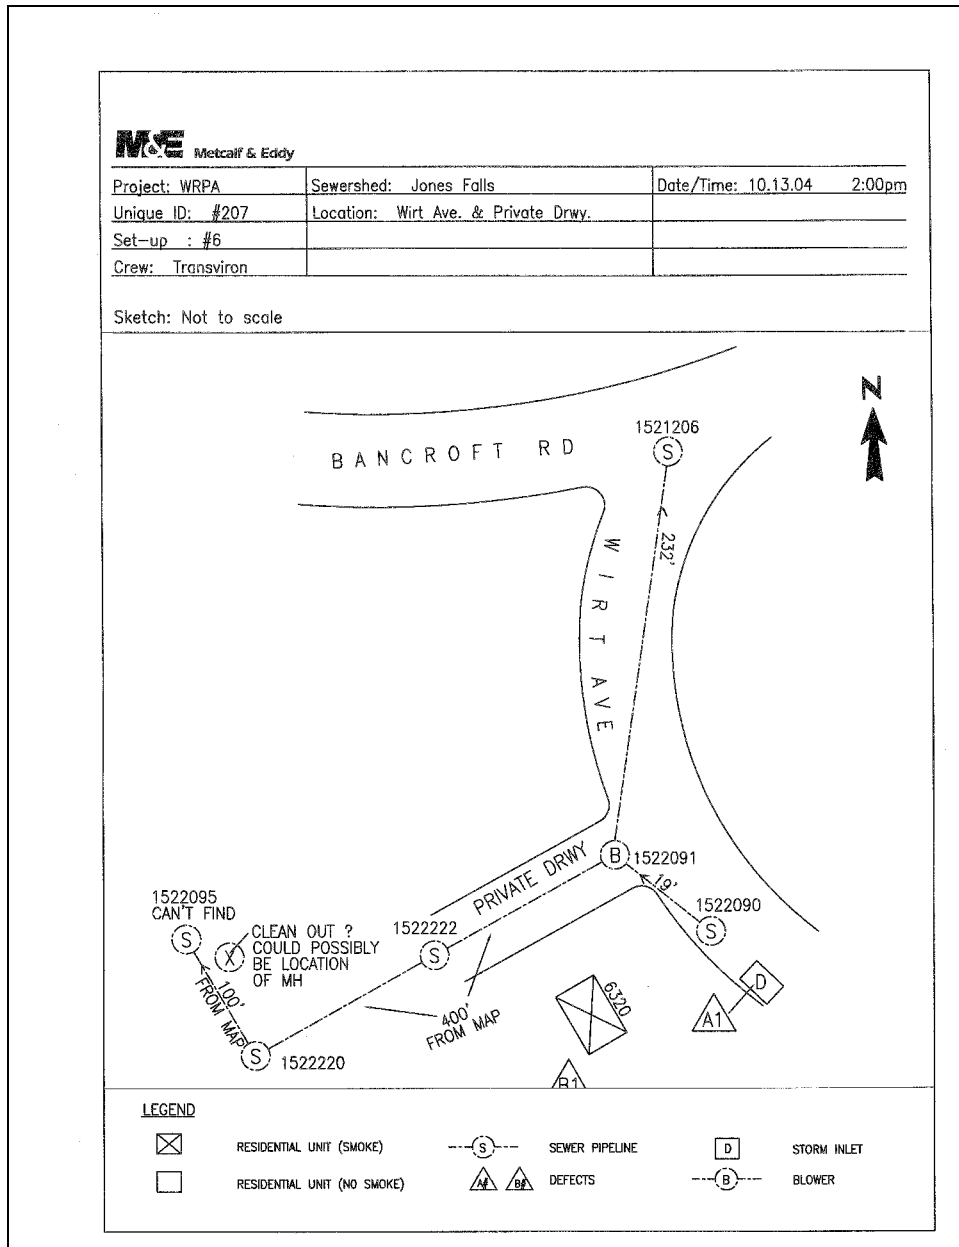

Sketch No: 207

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\207.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	208	Date:	10/13/2004	MeterBasin:	01_WR24
Observer ID:	A	Crew:	T-1	Dye Test Recommended:	N
Defect No:	1	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3320		Bancroft	ROAD

Source Type:	18= Other	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	75	

Comments: hole in ground

SMOKE TEST PHOTOS



Photo No: 27

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_A\A_2004_1013Image0027.JPG

Image Status: Image found and displayed.



Photo No: 28

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_A\A_2004_1013Image0028.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

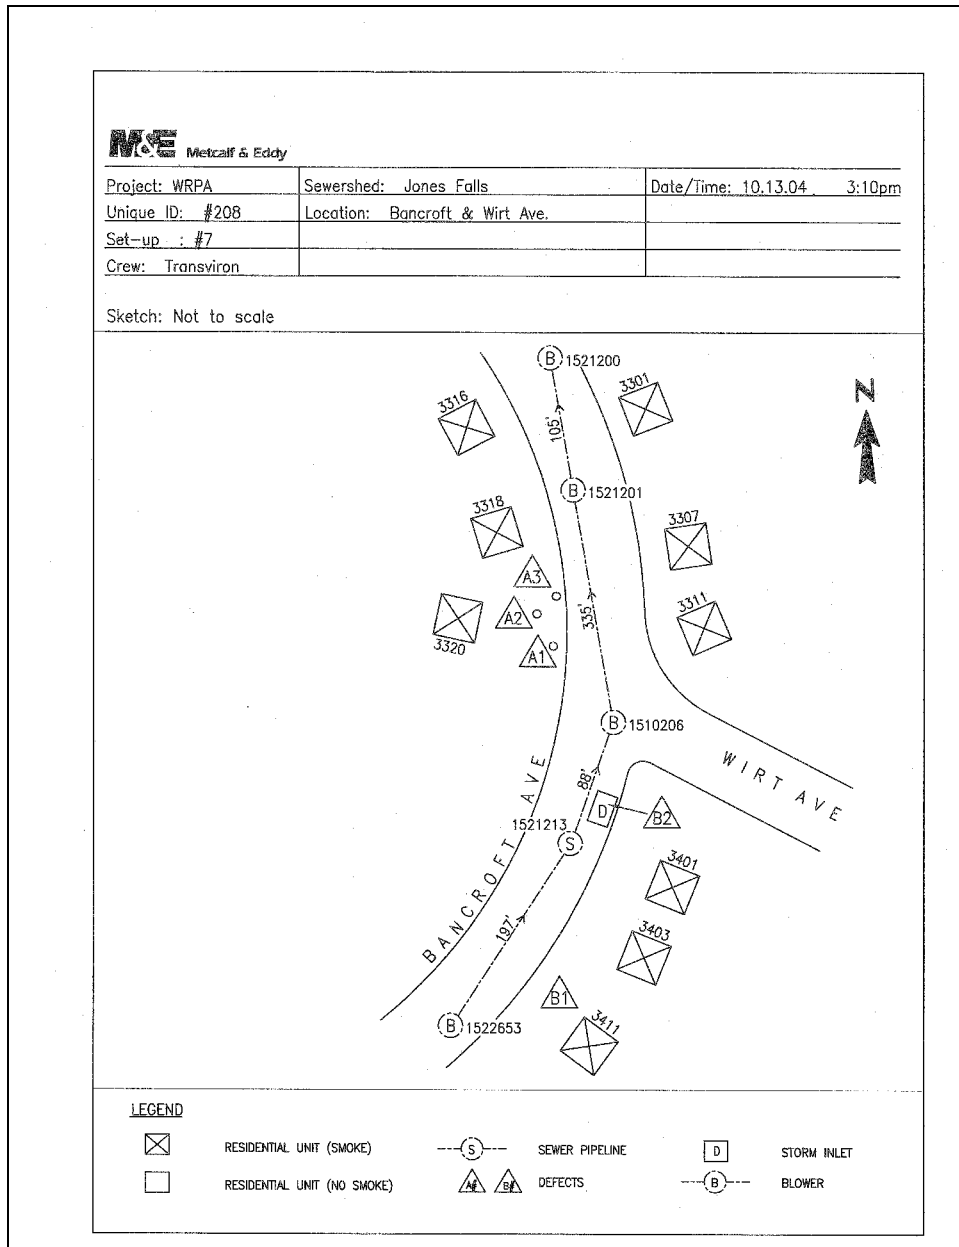

Sketch No: 208

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\208.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	208	Date:	10/13/2004	MeterBasin:	01_WR24
Observer ID:	A	Crew:	T-1	Dye Test Recommended:	N
Defect No:	2	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3320		Bancroft	ROAD

Source Type:	18= Other	Location:	7=Yard-Front	Severity:
---------------------	-----------	------------------	--------------	------------------

Sector:	1=Public	Drainage Area:	200
----------------	----------	-----------------------	-----

Comments: hole in ground

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 29

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_A\A_2004_1013Image0029.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

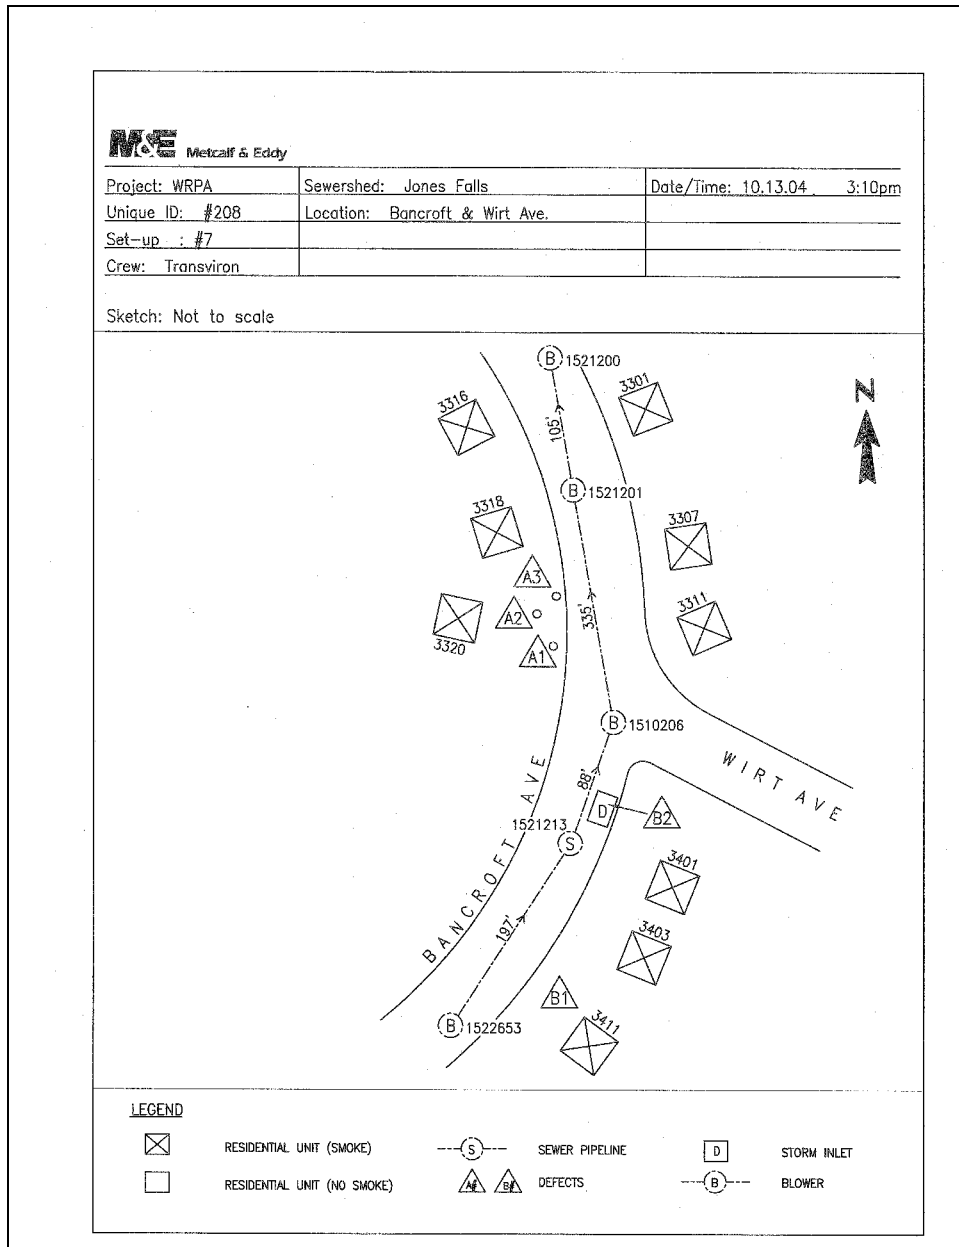

Sketch No: 208

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\208.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	208	Date:	10/13/2004	MeterBasin:	01_WR24
Observer ID:	A	Crew:	T-1	Dye Test Recommended:	N
Defect No:	3	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3320		Bancroft	ROAD

Source Type:	18= Other	Location:	6=Curb	Severity:
Sector:	1=Public	Drainage Area:	150	
Comments:	hole in ground			

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 30

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_A\A_2004_1013Image0030.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

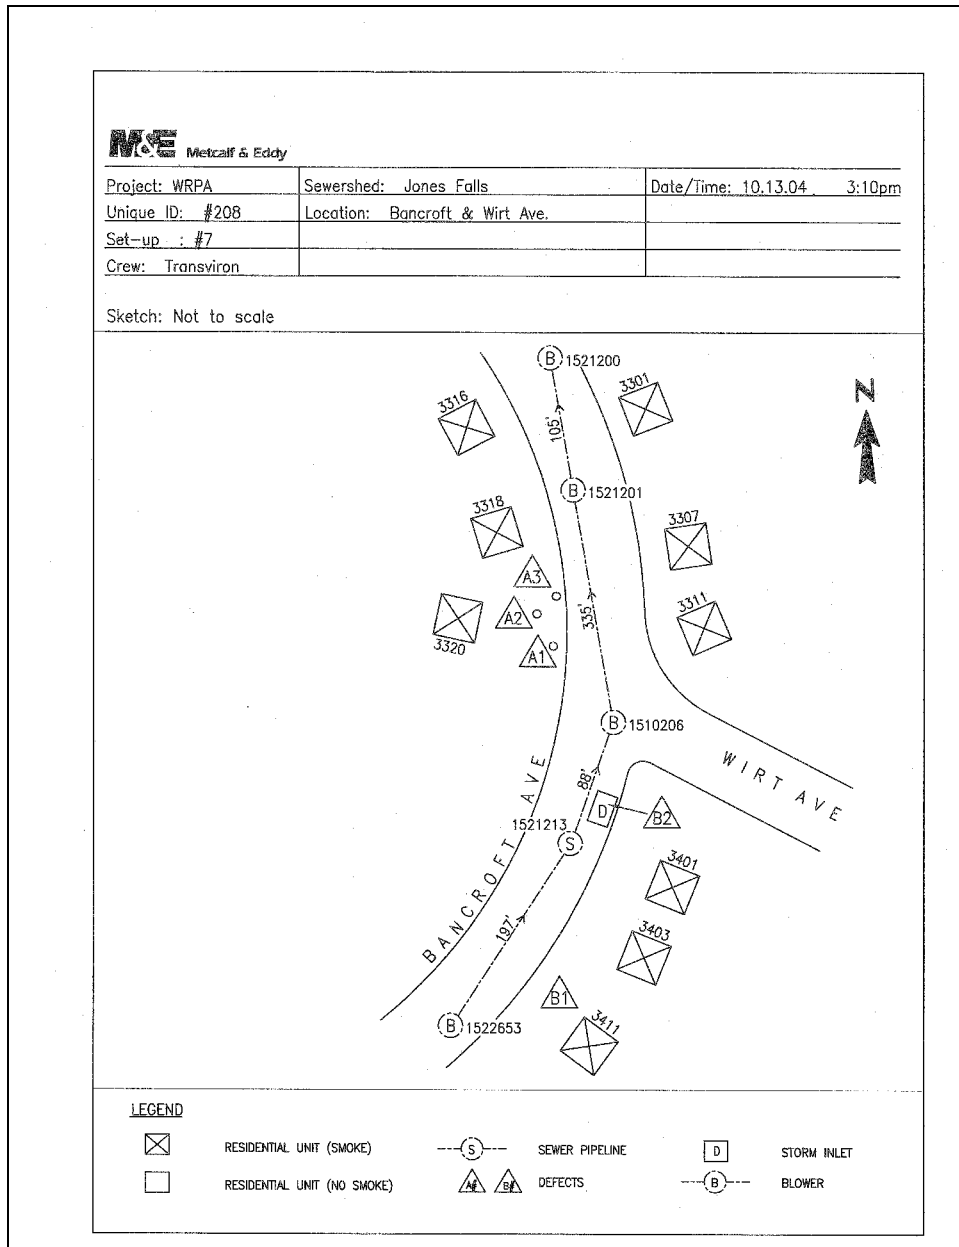

Sketch No: 208

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\208.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	208	Date:	10/13/2004	MeterBasin:	01_WR27
Observer ID:	B	Crew:	T-1	Dye Test Recommended:	N
Defect No:	1	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3411		Bancroft	ROAD

Source Type:	04= Cleanout	Location:	4=Driveway	Severity:
Sector:	2=Private	Drainage Area:	75	

Comments:

SMOKE TEST PHOTOS



Photo No: 34

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_B\B_2004_1013Image0034.JPG

Image Status: Image found and displayed.



Photo No: 35

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_B\B_2004_1013Image0035.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

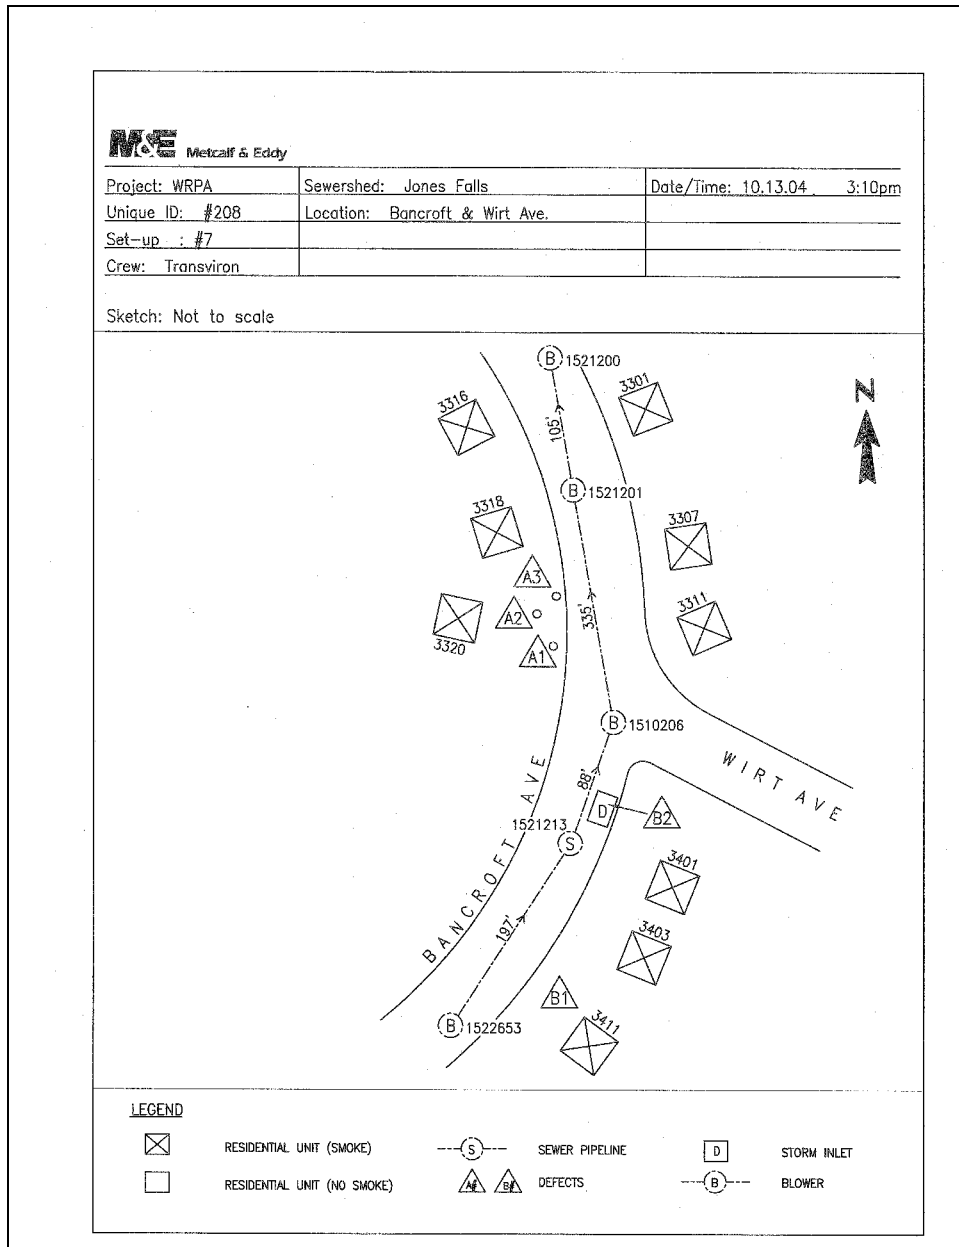

Sketch No: 208

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\208.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	208	Date:	10/13/2004	MeterBasin:	01_WR24
Observer ID:	B	Crew:	T-1	Dye Test Recommended:	Y
Defect No:	2	Setup No:	7	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3401		Bancroft	ROAD

Source Type:	14= Catch Basin	Location:	2=Paved Asphalt	Severity:
Sector:	1=Public	Drainage Area:	7800	

Comments:

SMOKE TEST PHOTOS



Photo No: 36

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_B\B_2004_1013Image0036.JPG

Image Status: Image found and displayed.



Photo No: 37

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1013-2004\T-1\PLAYER_B\B_2004_1013Image0037.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

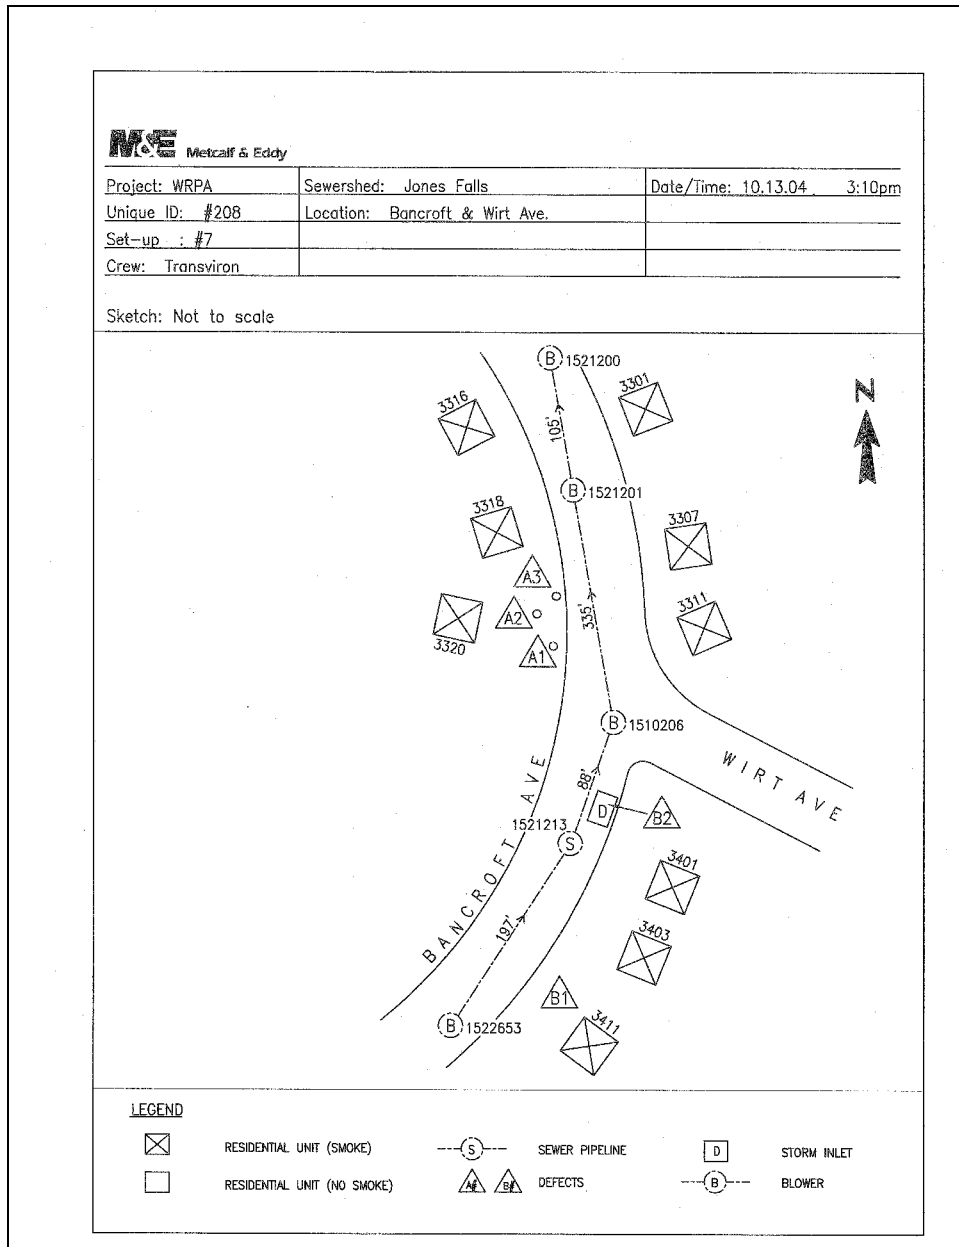

Sketch No: 208

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\208.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	209	Date:	10/13/2004	MeterBasin:	
Observer ID:	A	Crew:	T-1	Dye Test Recommended:	N
Defect No:	0	Setup No:	8	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

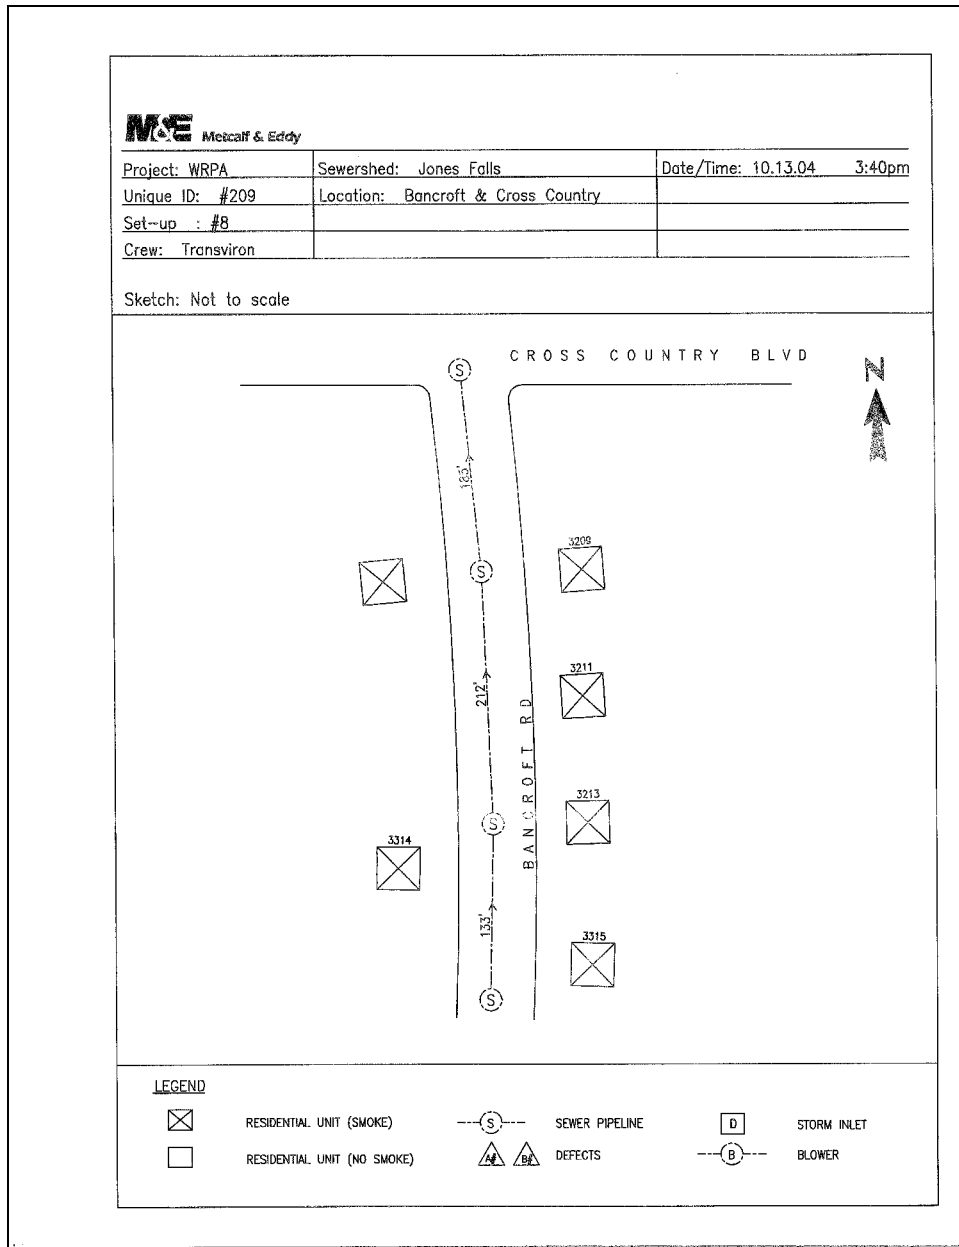

Sketch No: 209

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\209.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	209	Date:	10/13/2004	MeterBasin:	
Observer ID:	B	Crew:	T-1	Dye Test Recommended:	N
Defect No:	0	Setup No:	8	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:


Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

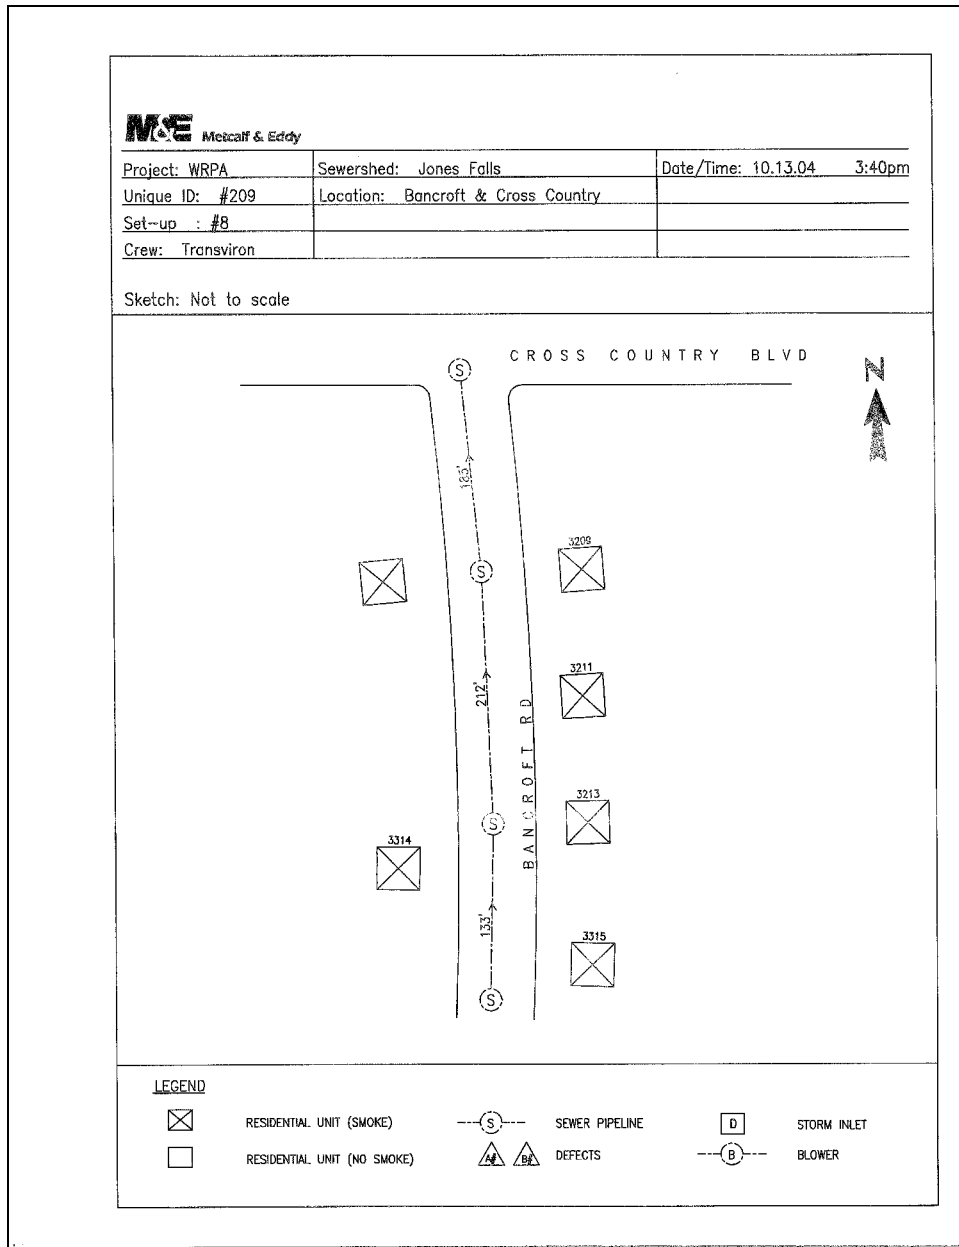

Sketch No: 209

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\209.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	210	Date:	10/4/2004	MeterBasin:	
Observer ID:		Crew:	T-2	Dye Test Recommended:	N
Defect No:	0	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
---------------------	-----------------------	---------------------	---------------------

Source Type:	Location:	Severity:
Sector:	Drainage Area: 0	
Comments: No defects observed		

SMOKE TEST PHOTOS

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 21
Setup No. 1
210

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 0850
Crew: T2	Street Location: Falls Rd		
US MH: 1520962	DS MH: 1521706	Number of Segments: 7	Test Length: 940'
Plugged US: (Y) N	Plugged DS: (Y) N	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? (Y) N	Recorder: Bob Blomk	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

The area around 1520962A, 1520962B + 1520962C is under construction.
1520962A + 1520962C do not have MH covers but are covered by plywood.
1520962B has a storm MH cover.
Last Revised 9/16/2004

Leader Form

Sketch No: 210

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\210.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	210	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	1	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3030		Fallstaff	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 307

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0307.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 21
Setup No. 1

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**210

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 0850
Crew: T2	Street Location: Falls Rd		
US MH: 1520962	DS MH: 1521706	Number of Segments: 7	Test Length: 940'
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1 2 3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Blomk	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

The area around 1520962A, 1520962B + 1520962C is under construction.
1520962A + 1520962C do not have MH covers but are covered by plywood.
1520962B has a storm MH cover.
Last Revised 9/16/2004

Leader Form

Sketch No:

210

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\210.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	211	Date:	10/4/2004	MeterBasin:	01_WR34
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3208		Clarks	LANE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS

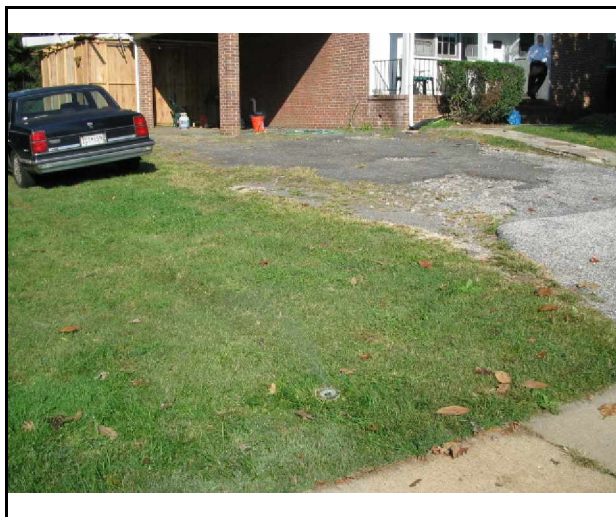


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 308

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0308.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 21
Setup No. 2
211

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: <u>10/4/04</u>	Start Time: <u>1010</u>
Crew: <u>T2</u>	Street Location: <u>Chicks Lane</u>		
US MH: <u>1521707</u>	DS MH: <u>1521129</u>	Number of Segments: <u>6</u>	Test Length: <u>986'</u>
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers <u>1 2 3</u>	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: <u>Bob Blank</u>	Comments: <u> </u>	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

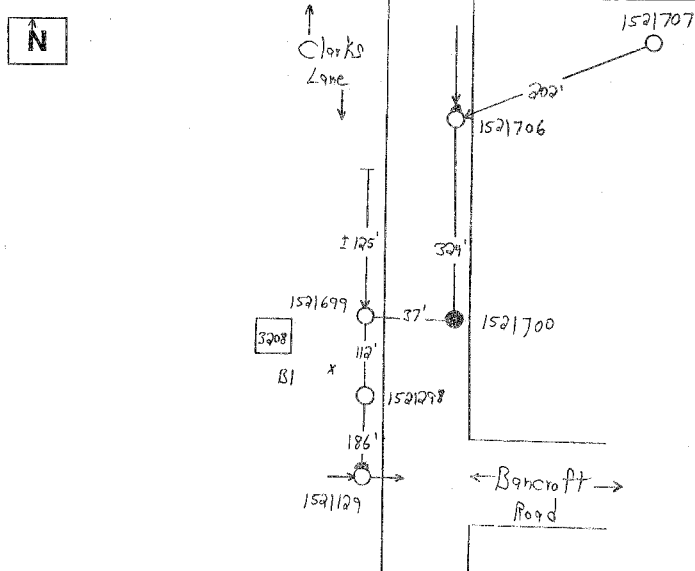

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

211

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\211.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3306		Clarks	LANE

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 309

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0309.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Bunch Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="radio"/> N	Plugged DS: <input checked="" type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

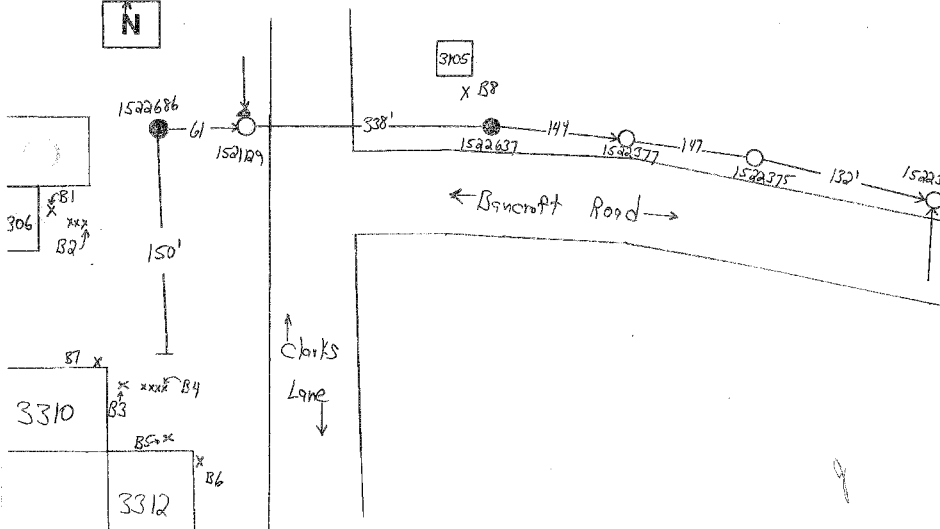

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3306		Clarks	LANE

Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	25	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 310

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0310.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Bunch Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

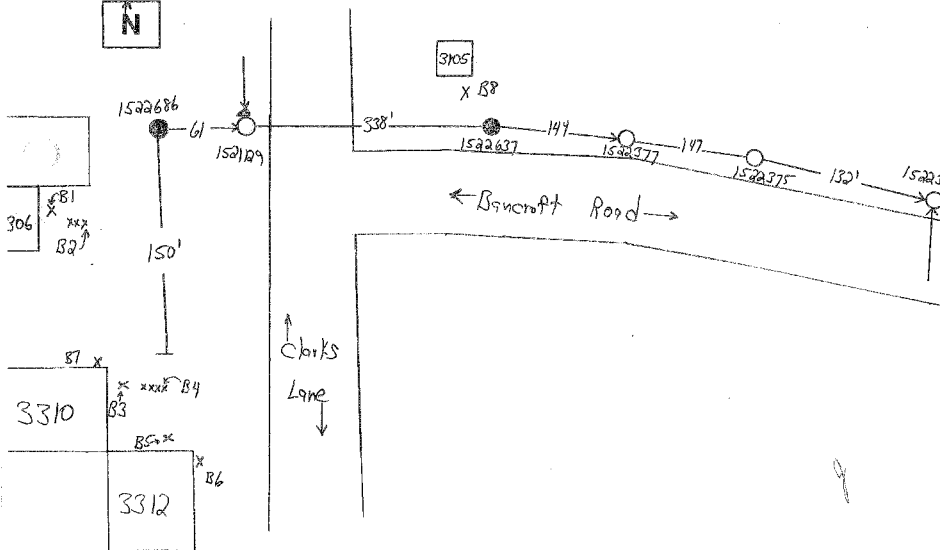

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3310		Clarks	LANE

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	48	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 311

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0311.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Burchett Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

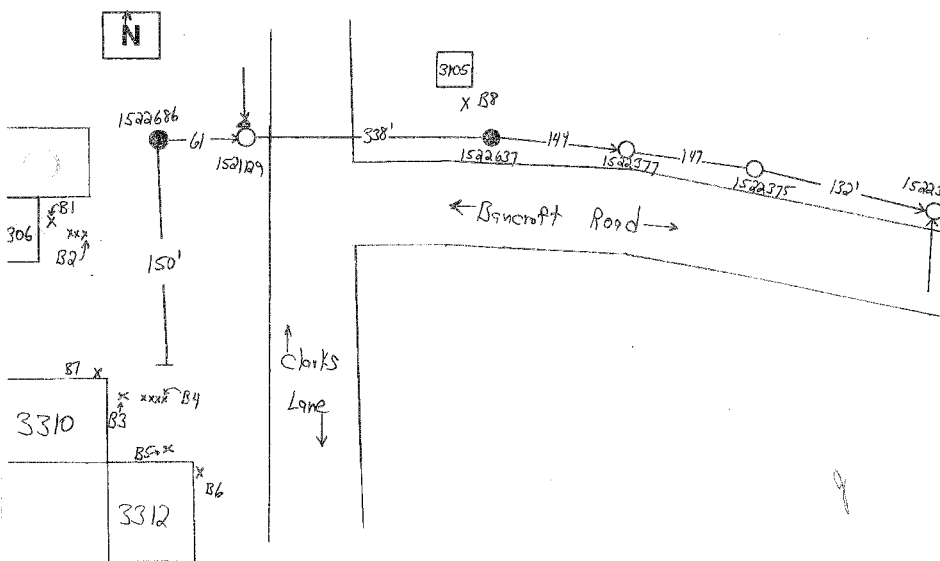

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	4	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:	
3310		Clarks	LANE	
Source Type:	02= Service Line	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	15	
Comments:				

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 312

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0312.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Burchett Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

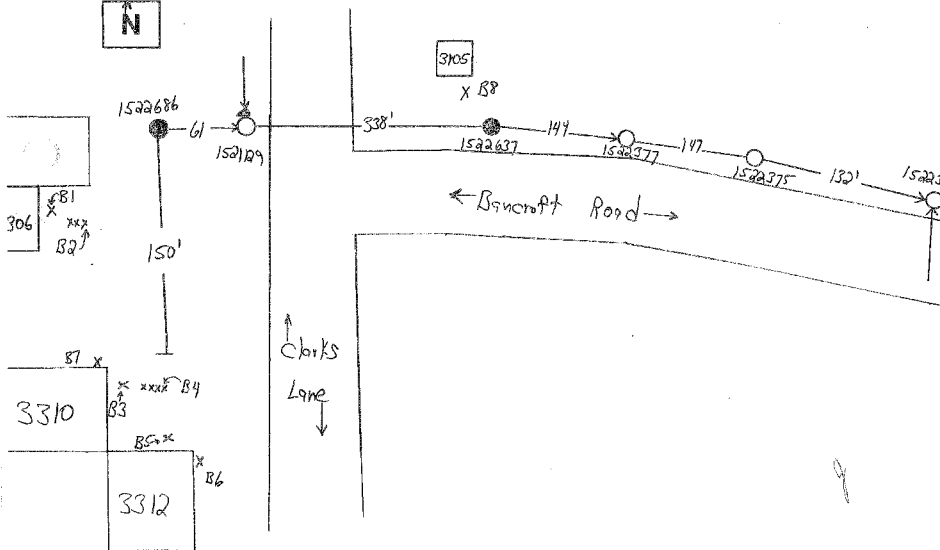

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	5	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3310		Clarks	LANE

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 313

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0313.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Burchett Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

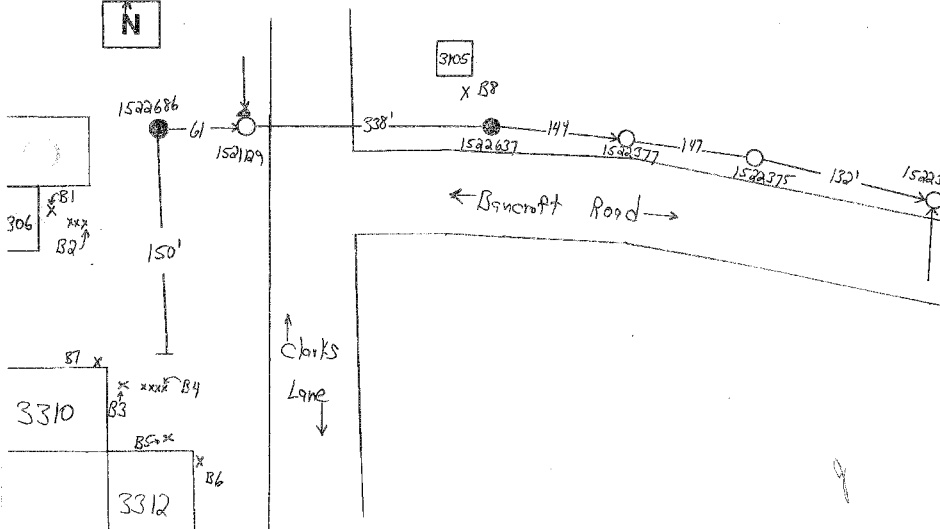

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	6	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3312		Clarks	LANE

Source Type:	05= Downspout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	1400	

Comments:

SMOKE TEST PHOTOS

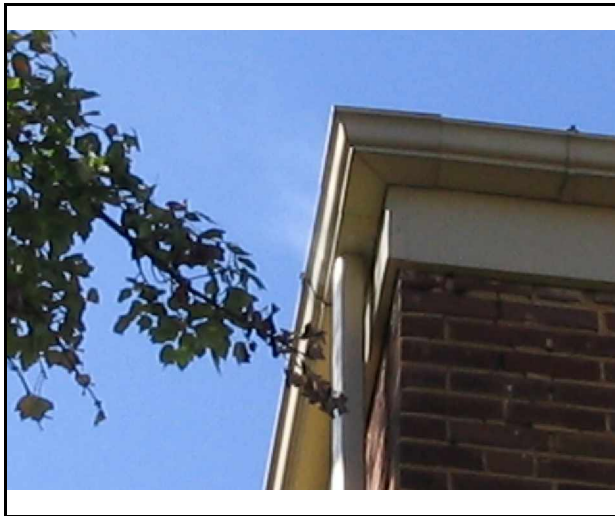


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 314

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0314.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Burchett Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="checkbox"/> N	Plugged DS: <input checked="" type="checkbox"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="checkbox"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="checkbox"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

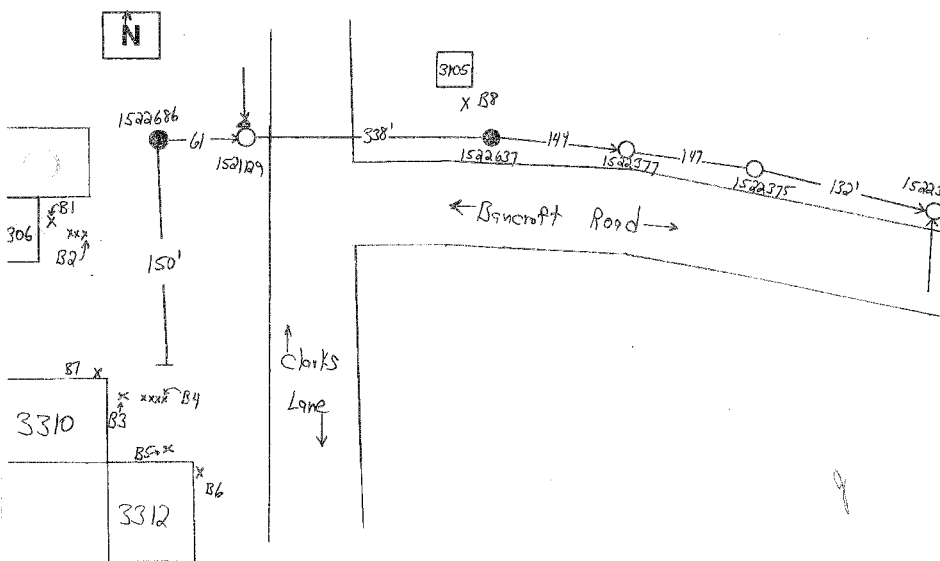

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	7	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3310		Clarks	LANE

Source Type:	05= Downspout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	600	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 315

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0315.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Burchett Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="radio"/> N	Plugged DS: <input checked="" type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

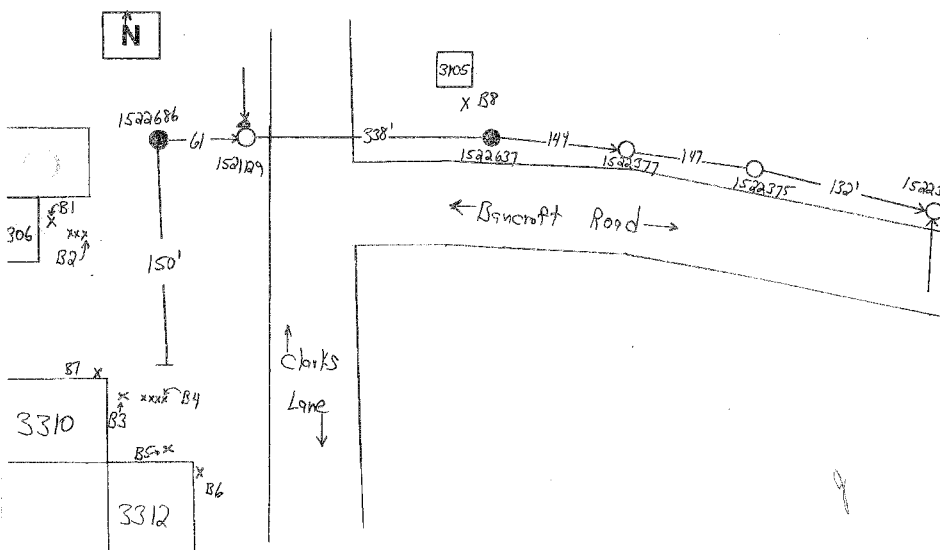

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	212	Date:	10/4/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	8	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3105		Bancroft	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	36	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 316

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\1004-2004\T-2\PLAYER_B\B_2004_1004Image0316.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 24
Setup No. 3
212

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 10/4/04	Start Time: 1045
Crew: T2	Street Location: Burchett Rd		
US MH: 1522686	DS MH: 1522372	Number of Segments: 6	Test Length: 972'
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry <input type="radio"/> Moderate <input type="radio"/> Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Bork	Comments: —	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

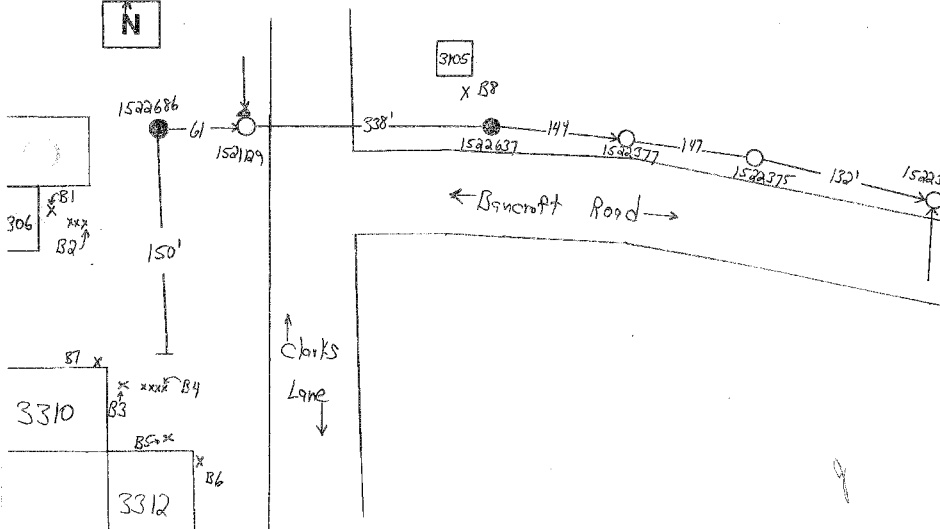

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

212

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\212.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.